


ASA110H + MBA110/1

Auswerteelektronik

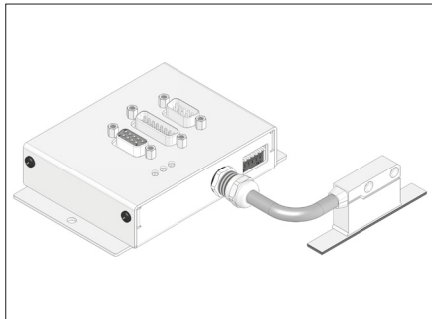

DEUTSCH

 
1. Gewährleistungshinweise

- Lesen Sie vor der Montage und der Inbetriebnahme dieses Dokument sorgfältig durch. Beachten Sie zu Ihrer eigenen Sicherheit und der Betriebssicherheit alle Warnungen und Hinweise.
- Ihr Produkt hat unser Werk in geprüftem und betriebsbereitem Zustand verlassen. Für den Betrieb gelten die angegebenen Spezifikationen und die Angaben auf dem Typenschild als Bedingung.
- Garantieansprüche gelten nur für Produkte der Firma SIKO GmbH. Bei dem Einsatz in Verbindung mit Fremdprodukten besteht für das Gesamtsystem kein Garantieanspruch.
- Reparaturen dürfen nur im Werk vorgenommen werden. Für weitere Fragen steht Ihnen die Firma SIKO GmbH gerne zur Verfügung.

2. Identifikation

Das Typenschild zeigt den Gerätetyp mit Variantennummer. Die Lieferpapiere ordnen jeder Variantennummer eine detaillierte Bestellbezeichnung zu.

z. B. ASA110H-0023




3. Mechanische Montage

Die Montage darf nur gemäß der angegebenen IP-Schutzart vorgenommen werden. Das System muss ggfs. zusätzlich gegen schädliche Umwelteinflüsse, wie z. B. Spritzwasser, Lösungsmittel, Staub, Schläge, Vibrationen oder starke Tempera-

turschwankungen geschützt werden.

3.1 Montage Auswerteelektronik

Das Gerät ist für die Montage mittels Schraubbefestigung vorgesehen. Die seitlich an den Laschen vorhandenen Bohrungen können zum direkten Anschrauben verwendet werden (siehe Abb. 1).

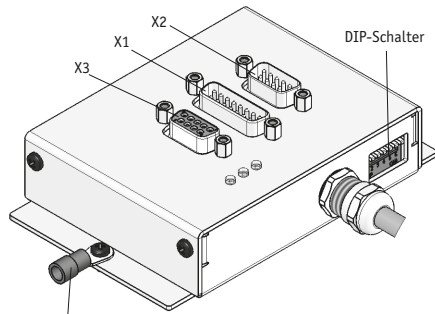

Anschlussmöglichkeit für Potentialausgleich

Abb. 1: Montage Auswerteelektronik/ Anschlüsse

3.2 Montage Magnetband

Die Montage muss plan zur Montagefläche bzw. der zu messenden Strecke erfolgen. Welligkeiten verschlechtern immer die Messgenauigkeit. Es ist für ausreichenden mechanischen Schutz zu sorgen (z. B. gegen Schläge und Vibration).

Aus technischen Gründen muss bei der Länge, gegenüber der Messstrecke, ein Zumaß von 100 mm berücksichtigt werden.

Achtung! Um **optimale Verklebungen** zu erreichen müssen alle antiadhäsiven Fremdstoffen (Öl, Fett, Staub usw.) durch möglichst rückstandslos verdunstende Reinigungsmittel entfernt werden. Als Reinigungsmittel eignen sich u. a. Ketone (Aceton) oder Alkohole, die u. a. von den Firmen Loctite und 3M als Schnellreiniger angeboten werden. Die Klebeflächen müssen trocken sein und es ist mit höchstmöglichem Anpressdruck zu verkleben. Die Verklebungstemperatur ist optimal zwischen 20 °C und 30 °C in trockenen Räumen.

Tip! Bei Verklebung langer Bänder sollte die Schutzfolie des Klebbandes über eine kurze Teilstrecke abgezogen werden, um das Band zu fixieren. Daraufhin erfolgt das Ausrichten des Bandes. Nun kann über die restliche Länge die Schutzfolie, unter gleichzeitigem Andruck des Bandes, seitlich herausgezogen werden (als Andruckhilfe kann z. B. eine Tapetenandrückwalze verwendet werden).

Montageschritte (siehe Abb. 2)

- Befestigungsfläche (1) sorgfältig reinigen.
- Am Magnetband die Schutzfolie (2) des Klebebandes (3) entfernen.
- Magnetband (4) aufkleben. Aktive Fläche nach oben, erkennbar am Aufdruck.
- Magnetbandoberfläche sorgfältig reinigen.
- Am Abdeckband (5) die Schutzfolie (6) des Klebebandes entfernen.
- Abdeckband aufkleben (an beiden Enden leicht überlappen lassen).
- Die überlappenden Enden des Abdeckbandes gegen Ablösen sichern.

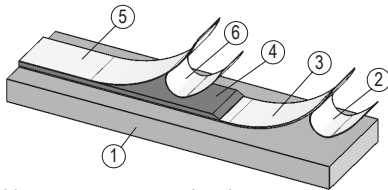


Abb. 2: Montage Magnetband



Achtung! Die Beeinflussung durch magnetische Felder ist zu vermeiden. Insbesondere dürfen keine Magnetfelder (z. B. Haftmagnete, Dauermagnete oder magnetisierte Maschinenteile) in direkten Kontakt mit dem Magnetband geraten. Gleiches gilt für den Sensor im Betrieb.

Montagebeispiele

Die einfache Montageart durch angeschrägtes Magnetband (siehe Abb. 3) ist nur in sehr geschützter Umgebung zu empfehlen. Bei ungeschützter Umgebung besteht Abschälgefahr. In solchen Fällen ist die Montageart wie in Abb. 4 und Abb. 5 gezeigt, geeigneter.

Den optimalen Schutz bietet die Montage in einer Nut (siehe Abb. 6), die so tief sein sollte, dass das Magnetband vollständig darin eingebettet werden kann.

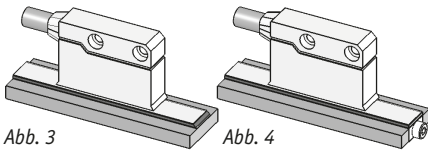


Abb. 3

Abb. 4

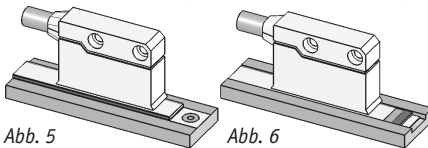


Abb. 5

Abb. 6

3.3 Montage Sensor

Bei der Montage ist insbesondere zu beachten, dass über die gesamte Messstrecke zwischen Band und Sensor ein Luftspalt eingehalten wird, unabhängig ob das Band oder der Sensor bewegt werden (siehe Abb. 7).

Innerhalb der angegebenen Lageabweichung (siehe Abb. 7) ist der Messfehler vernachlässigbar.

Der maximale Abstand zwischen Sensorkopf und Magnetband ohne Abdeckband beträgt 0.4 mm. Bei Verwendung eines Abdeckbandes reduziert sich der eff. Abstand um die Dicke des Abdeckbandes inkl. Klebefolie. Der Sensor darf das Magnetband nicht berühren.

Die Addition der Montagetoleranzen in allen Ebenen muss vermieden werden.

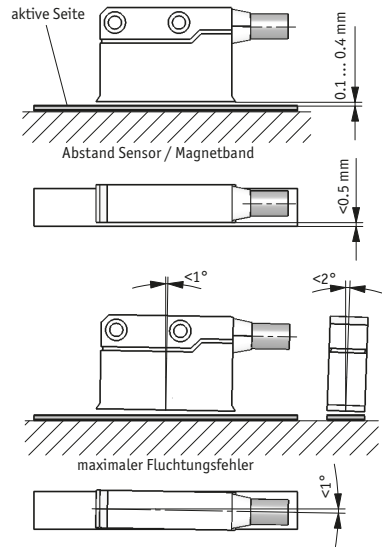


Abb. 7: Montagetoleranzen

Achtung! Die Lage des Sensors zum Magnetband ist genau definiert (siehe Abb. 8).

 


Abb. 8: Ausrichtung Band/Sensor

4. Elektrischer Anschluss

- Anschlussverbindungen dürfen nicht unter Spannung geschlossen oder gelöst werden!
- Verdrahtungsarbeiten dürfen nur spannungslos erfolgen!

- Vor dem Einschalten sind alle Leitungsanschlüsse und Steckverbindungen zu überprüfen.
- Um eine störungsfreie Funktion des Gerätes sicherzustellen, ist der fachgerechte Anschluss der Auswerteeinheit und des Sensorkopfes an den Potentialausgleich unbedingt erforderlich. Um dies sicherzustellen, sind dem Lieferumfang je eine Ringöse für den Anschluss einer max. 2,5 mm² Leitung, alternativ ein Flachsteckerverbinder sowie eine Zahnscheibe beigelegt. Der Anschluss sollte so kurz wie möglich ausgeführt werden (siehe Abb. 1).

Hinweise zur Störsicherheit

Alle Anschlüsse sind gegen äußere Störeinflüsse geschützt. **Der Einsatzort ist aber so zu wählen, dass induktive oder kapazitive Störungen nicht auf den Sensor oder dessen Anschlussleitung einwirken können!** Durch geeignete Kabelführung und Verdrahtung können Störeinflüsse (z. B. von Schaltnetzteilen, Motoren, getakteten Reglern oder Schützen) vermindert werden.

Erforderliche Maßnahmen:

- Nur geschirmtes Kabel verwenden. Den Kabelschirm beidseitig auflegen. Litzenquerschnitt der Leitungen 0,25 mm².
- Die Verdrahtung von Abschirmung und Masse (0 V) muss sternförmig und großflächig erfolgen. Der Anschluss der Abschirmung an den Potentialausgleich muss großflächig (niederimpedant) erfolgen.
- Das System muss in möglichst großem Abstand von Leitungen eingebaut werden, die mit Störungen belastet sind; ggfs. sind **zusätzliche Maßnahmen wie Schirmbleche oder metallisierte Gehäuse** vorzusehen. Leitungsführungen parallel zu Energieleitungen vermeiden.
- Schutzspulen müssen mit Funkenlöschgliedern beschaltet sein.
- Um die Störfestigkeit der ASA110H zu erhöhen, ist es notwendig die Anschlussleitungen für die Versorgungsspannung und Ausgangssignale mit jeweils einer Ferrit-Hülse zu versehen, die in möglichst geringem Abstand zu der D-SUB Verbindung montiert werden sollte. Da der Außendurchmesser von der Art der verwendeten Anschlussleitung abhängt, sollte die Hülse möglichst passgerecht ausgewählt werden.
- Eine Verlängerung bzw. Auftrennen der Sensorleitung ist nicht zulässig.

Spannungsversorgung: 24 V DC ±20 %

Leistungsaufnahme: <5 Watt

 
4.1 Anschlussbelegung

Die Ausgangssignale und die Versorgungsspannung werden über 9-polige bzw. 15-polige D-SUB-Steckverbindungen geführt (siehe Abb. 1).

Achtung! Um eine sichere elektrische Verbindung zu gewährleisten, ist es erforderlich, die D-SUB-Verbindungen mit der zugehörigen Schraubverriegelung zu fixieren.



Anschlussbelegung X1 (15-pol. D-SUB Stift)



Schnittstelle digital: 2xLine Driver

Pin	Signal	Beschreibung
1	A	Quadratur-Signal A
2	/A	Quadratur-Signal /A
3	+24 V DC*	Spannungsversorgung Auswerteelektronik (24 V DC ±20 %)
4	0 V*	für Auswerteelektronik
5	nc	
6	nc	
7	SSI_DATA	Positiver Datenausgang SSI
8	/SSI_DATA	Invertierter Datenausgang SSI
9	B	Quadratur-Signal B
10	/B	Quadratur-Signal /B
11	nc	
12	SSI_GND	für Auswerteelektronik SSI
13	nc	
14	SSI_CLK	Positiver Takteingang SSI
15	/SSI_CLK	Invertierter Takteingang SSI


* gilt nur für Software S

Schnittstelle digital: Line Driver; Ohne

Pin	Signal	Beschreibung
1	nc	
2	nc	
3	+24 V DC*	Spannungsversorgung Auswerteelektronik (24 V DC ±20 %)
4	0 V*	für Auswerteelektronik
5	nc	
6	nc	
7	SSI_DATA	Positiver Datenausgang SSI
8	/SSI_DATA	Invertierter Datenausgang SSI
9	nc	
10	nc	
11	nc	
12	SSI_GND	für Auswerteelektronik SSI
13	nc	
14	SSI_CLK	Positiver Takteingang SSI
15	/SSI_CLK	Invertierter Takteingang SSI

* gilt nur für Software S

 Anschlussbelegung X2 (9-pol. D-SUB Stift)




Schnittstelle digital: Line Driver; 2xLine Driver

Pin	Signal	Beschreibung
1	A	Quadratur-Signal A
2	B	Quadratur-Signal B
3	nc	
4	+24 V DC	Spannungsversorgung Auswerteelektronik (24 V DC $\pm 20\%$)
5	0 V	für Auswerteelektronik
6	/A	Quadratur-Signal /A
7	/B	Quadratur-Signal /B
8	DÜA	Datenausgang RS485
9	DÜB	Datenausgang RS485

Schnittstelle digital: Ohne

Pin	Signal	Beschreibung
1	nc	
2	nc	
3	nc	
4	+24 V DC	Spannungsversorgung Auswerteelektronik (24 V DC $\pm 20\%$)
5	0 V	für Auswerteelektronik
6	nc	
7	nc	
8	DÜA	Datenausgang RS485
9	DÜB	Datenausgang RS485

 Anschlussbelegung X3 (9-pol. D-SUB Buchse)



Schnittstelle analog: 1Vss

Pin	Signal	Beschreibung
1	Sin	Analogsignal Sinus
2	/Sin	Analogsignal Sinus invertiert
3	Cos	Analogsignal Cosinus
4	nc	
5	nc	
6	nc	
7	ANA_GND	für Analogsignal
8	/Cos	Analogsignal Cosinus invertiert
9	nc	

5. Fehlerbehandlung

Typische Fehler, die bei der Montage und während des Betriebes auftreten können:


- Die ASA110H ist nicht, oder nicht korrekt angeschlossen (Anschlussbelegung siehe Kapitel 4.1).
- Die Abstandstoleranz zwischen Sensor/ Band wurde nicht eingehalten (über die **gesamte** Messstrecke!) oder der Sensor streift auf dem Magnetband.
- Kabelunterbrechung / Abtrennung durch scharfe Kanten / Quetschung.
- Der Sensor ist mit der aktiven Seite vom Band abgewandt montiert (siehe Abb. 7 und 8).
- Sensor und Band sind falsch zueinander ausgerichtet (siehe Kapitel 3.3).
- Magnetische Felder in unmittelbarer Nähe der Messfläche verfälschen die Messwerte, ggf. sind Maßnahmen zur Abschirmung nötig. Solche Felder können von Haftmagneten, Dauermagneten oder magnetischen Maschinenteilen verursacht werden.
- Falsche Messwerte infolge von EMV-Störungen (siehe Kapitel 4).
- Die eingestellte Betriebsart entspricht nicht der angeschlossenen Hardware.

Die Softwarebeschreibung ist dem Beiblatt zu entnehmen.



ASA110H + MBA110/1

Translation module

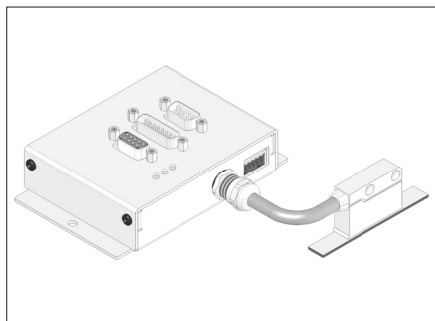

ENGLISH

1. Warranty information

- In order to carry out installation correctly, we strongly recommend this document is read very carefully. This will ensure your own safety and the operating reliability of the device.
- Your device has been quality controlled, tested and is ready for use. Please observe all warnings and information which are marked either directly on the device or specified in this document.
- Warranty can only be claimed for components supplied by SIKO GmbH. If the system is used together with other products, there is no warranty for the complete system.
- Repairs should be carried out only at our works. If any information is missing or unclear, please contact the SIKO sales staff.

2. Identification

Please check the particular type of unit and type number from the identification plate. Type number and the corresponding version are indicated in the delivery documentation.

e. g. ASA110H-0023


version number
 type of unit

3. Installation

For mounting, the degree of protection specified must be observed. If necessary, protect the unit against environmental influences such as sprayed water, dust, knocks, extreme temperatures.

3.1 Mounting device

The unit has been designed for screw fixation - via the lateral mounting tabs / bores (see fig. 1).

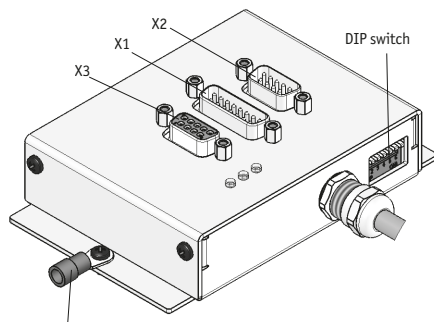

Connection possibility for potential equalization

Fig. 1: Mounting / connections

3.1 Mounting the magnetic strip

The mounting surface/measuring track must be flat. Buckles or bumps will lead to inaccurate measurement results. Please protect the magnetic strip from mechanical damage (e. g. against shocks and vibration).

For technical reasons the strip should be approx. 100 mm longer than the actual measuring distance.

Attention! To guarantee **optimal adhesion** oil, grease dust etc. must be removed by using cleaning agents which evaporate without leaving residues. Suitable cleansing agents are e. g. ketones (acetone) or alcohols; the companies Loctite and 3M can both supply such cleaning liquid. Make sure that the surface to be glued is dry and apply the strip with maximum pressure. Glueing should preferably be carried out at temperatures between 20 °C to 30 °C and in dry atmosphere.



Advice! When applying long pieces of magnetic strip do not immediately remove the complete protective foil, but rather peel back a short part from the end sufficient to fix the strip. Now align the strip. As the protective strip is then peeled back and out press the tape firmly onto the mounting surface. A wall paper roller wheel could be used to assist in applying pressure onto the magnetic strip when fixing it in position.

Mounting steps (see fig. 2)

- Clean mounting surface (1) carefully.
- Remove protective foil (2) from the adhesive side of the magnetic strip (3).
- Stick down the magnetic strip (4). Active surface upwards (see marking on the strip).

- Clean surface of magnetic strip carefully.
- Remove protective foil (6) from adhesive tape on the cover strip (5).
- Fix cover strip (both ends should slightly overlap).
- Also fix cover strip's ends to avoid unintentional peeling.

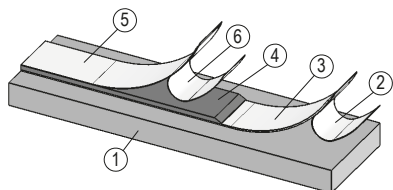


Fig. 2: Mounting the magnetic strip



Attention! Do not expose the magnetic strip to magnetic fields. Any direct contact of the magnetic strip with magnetic fields (e. g. adhesive magnets, permanent magnets or magnetized machinery parts) is to be avoided. The same applies to the sensor during operation.

Mounting examples

Mounting with chamfered ends (see fig. 3) is not recommended unless the strip is installed in a safe and protected place without environmental influences. In less protected mounting locations the strip may peel. There we recommend mounting accord. to fig. 4 and 5.

Mounting in a groove (see fig. 6) best protects the magnetic strip. The groove should be deep enough to totally embed the magnetic strip.

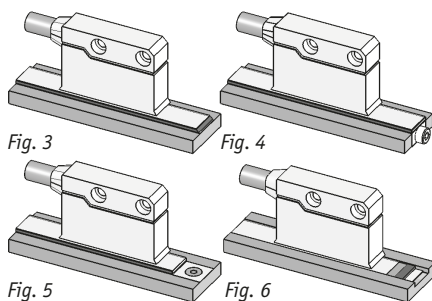


Fig. 3

Fig. 4

Fig. 5

Fig. 6

3.3 Sensor mounting

The correct gap between sensor and magnetic strip must be maintained over the total travel distance, irrespective whether the strip or sensor moves (see fig. 7).

Within the defined limits (see fig. 7), errors due to deviation are less important than errors resulting

from strip and sensor tolerances.

The max. gap between sensor head and magnetic band without cover strip is 0.4 mm. When using cover strip, the gap is reduced by the thickness of cover strip including its adhesive tape. Sensor must not touch the magnetic strip.

An accumulation of the different possible mounting tolerances should be avoided.

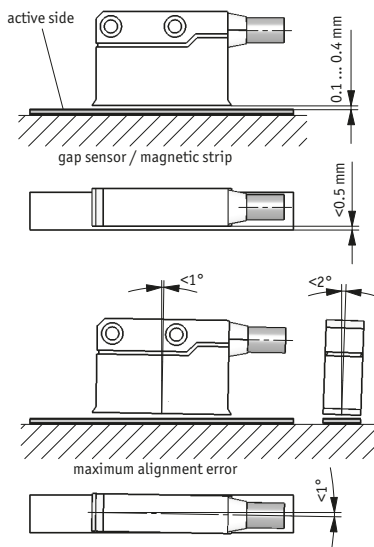


Fig. 7: Mounting tolerances

Attention! The position of the sensor with respect to the magnetic strip is exactly defined (see fig. 8).

 


Fig. 8: Strip/sensor orientation

4. Electrical connection

- Live connections must neither be closed nor removed!
- Wiring must only be carried out with power off!
- Check all lines and connections before switching on the equipment.
- In order to ensure flawless functioning of the device, it is absolutely necessary that the translation module and sensor head be connected to potential equalization in a workmanlike manner. To enable this, each a ring eye for connecting a max. 2.5 mm² cable, alternately a tab as well as a tooth lock

washer are enclosed in the delivery. The connection should be as short as possible (see fig. 1).

Interference and distortion

All connections are protected against the effects of interference. **The location should be selected to ensure that no capacitive or inductive interferences can affect the sensor or the connection lines!** Suitable wiring layout and choice of cable can minimise the effects of interference (e. g. interference caused by SMPS, motors, cyclic controls and contactors).

Necessary measures:

- Only screened cable should be used. Screen should be connected to earth at both ends. Wire cross section is to be at 0.25 mm².
- Wiring to the screen and ground (0 V) must be secured to a good point. Ensure that the connection of the screen and earth is made to a large surface area with a sound connection to minimise impedance.
- The system should be positioned well away from cables with interference; if necessary a **protective screen or metal housing** must be provided. The running of wiring parallel to the mains supply should be avoided.
- Contactor coils must be linked with spark suppression.
- To enhance interference resistance of the ASA110H, the service line for supply voltage and output signals must be equipped with a ferrite sleeve mounted at the smallest possible distance from the D-SUB connection. The sleeve should be chosen so as to fit exactly since the external diameter depends on the type of service line used.
- Extension or splitting of the sensor cable is not permitted.

Power supply: 24 V DC ±20 %

Power consumption: <5 Watt

 
4.1 Connection of the translation module

Output signals and voltage supply are connected to the 9-poles D-Sub or 15 poles D-Sub terminal strip (see fig. 1).



Attention! In order to ensure safe electrical connection, it is necessary that the D-SUB connections be fastened with the appropriate screw lock.

Connector connection X1 (15 pole D-SUB male)



Digital interface: 2xLine Driver

Pin	Signal	Description
1	A	quadrature signal A
2	/A	quadrature signal /A
3	+24 V DC*	power supply of translation module (24 V DC ±20 %)
4	0 V*	for translation module
5	nc	
6	nc	
7	SSI_DATA	positive data output SSI
8	/SSI_DATA	inverted data output SSI
9	B	quadrature signal B
10	/B	quadrature signal /B
11	nc	
12	SSI_GND	for translation module SSI
13	nc	
14	SSI_CLK	positive cycle input SSI
15	/SSI_CLK	inverted cycle input SSI


* is valid only for software S

Digital interfaces: Line Driver; Without

Pin	Signal	Description
1	nc	
2	nc	
3	+24 V DC*	power supply of translation module (24 V DC ±20 %)
4	0 V*	for translation module
5	nc	
6	nc	
7	SSI_DATA	positive data output SSI
8	/SSI_DATA	inverted data output SSI
9	nc	
10	nc	
11	nc	
12	SSI_GND	for translation module SSI
13	nc	
14	SSI_CLK	positive cycle input SSI
15	/SSI_CLK	inverted cycle input SSI

* is valid only for software S

 Connector connection X2 (9 pole D-SUB male)




Digital interfaces: Line Driver; 2xLine Driver

Pin	Signal	Description
1	A	quadrature signal A
2	B	quadrature signal B
3	nc	
4	+24 V DC	power supply of translation module (24 V DC $\pm 20\%$)
5	0 V	for translation module
6	/A	quadrature signal /A
7	/B	quadrature signal /B
8	DÜA	data output RS485
9	DÜB	data output RS485

Digital interface: Without

Pin	Signal	Description
1	nc	
2	nc	
3	nc	
4	+24 V DC	power supply of translation module (24 V DC $\pm 20\%$)
5	0 V	for translation module
6	nc	
7	nc	
8	DÜA	data output RS485
9	DÜB	data output RS485

 Connector connection X3 (9 pole D-SUB female)



Analog interface: 1Vss

Pin	Signal	Description
1	Sin	analog signal Sinus
2	/Sin	analog signal Sinus inverted
3	Cos	analog signal Cosinus
4	nc	
5	nc	
6	nc	
7	ANA_GND	for analog signal
8	/Cos	analog signal Cosinus inverted
9	nc	

5. Trouble shooting

Below there are some typical errors which may occur during installation and operation:

- The ASA110H is not or incorrectly connected (connector connection see chapter 4.1).
- Tolerance for the gap between magnetic sensor and magnetic strip not observed over the **total** travel distance. Sensor touches strip.
- Cable squeezed / interrupted / cut by sharp edges.
- Sensor's active side not mounted towards the magnetic strip (see fig. 7 and 8).
- Sensor and strip are aligned incorrectly towards each other (see chapter 3.3).
- Magnetic fields next to the measurement area falsify the measured values; screening may be required. Such fields can be caused by magnetic clamps, permanent magnets or magnetic machine parts.
- Wrong measuring values due to EMC interferences (see chapter 4).
- The operating mode set does not correspond with the hardware connected.

For software description please refer to the supplementary sheet.



SIKO GmbH

Werk / Factory:

Weiherrmattenweg 2
79256 Buchenbach-Unteribental

Postanschrift / Postal address:

Postfach 1106
79195 Kirchzarten

Telefon/Phone +49 7661 394-0

Telefax/Fax +49 7661 394-388

E-Mail info@siko.de

Internet www.siko-global.com

Service support@siko.de